

Work Order ID 135164

July 31, 2015 3:25:08 PM

U/R

A.R.
15.08.11.0

135164

Page 1

Item ID: D350-748-243TRN

Accept

N9000040100

Setup Start

NS1

Revision ID:

Stop

NS2

Item Name: Crosstube Installation, High Aft

Start Date: 7/31/2015 Start Qty: 1.00

1

Cust Item ID:

Required Date: 8/14/2015 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals: Process Plan: *SH*

Date: **20150731**

Tooling:

Date:

Run Start

NR1

QC:

Date:

SPC (Y/N):

Date:

Stop

NR2

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

Draw Nbr	Revision Nbr
----------	--------------

D350-748-243	A
--------------	---

100

0.00

100

MORI SEIKI CNC LATHE LARGE

Mori Seiki

Memo

0.03

Mori Seiki CNC Lathe Large

1-Fill tube with sand & install plugs on both ends as per Folio _____

2-Turn first side as per Folio _____

3- File transition lines smooth.

FOLIO REV: *14*

DWG REV: *2*

1 *CP*

mmml
15/08/14

110

QC1- Inspection performed by CMM

0.00

110

QC

Memo

0.00

Quality Control

1 *CP*

mmml
15/08/17

DQA:

Date: 15/09/28



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed:

Date: 15/09/22

Work Order update only ☐

Work Order: 135764		DISPOSITION		AGAINST DEPARTMENT/PROCESS			
Part No. 12350-748-213TRN		Rework ☐		Skid-tube ☐	Cross tube ☒	Water Jet ☐	Engineering ☐
NCR No. 15-5355		Scrap ☐		Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐
		Use-as-is ☒		Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐
		Suspected Unapproved ☐		Large Fab ☐	Composite ☐	Supplier ☐	
Date: 15-09-08		Step #: 130		QTY Effective: ①		MRB (QSI042) Approval	
Description Work Order Deviation				Disposition		DAS 12 9-89 K5/4/9	
Wall thickness measurement is out of tolerance.				Acceptable. Min. wall is within 0.020 of dys nominal.		Completed By DAS 47 15-9-9 9-89 Lead hand / Supervisor Approval Verification DAS 47 15-9-9 9-89 QC / QA Coordinator Approval DAS 9 9-89 15-09-08	
Root Cause				FAULT CATEGORY			
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐		
Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐		
Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☒		
Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐		
Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐		
Material ☒	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐		
Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐		
Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐		
LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐		
Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐		
Past Expiry Date ☐	Manufacturing Process ☐						
Misidentified ☐	Past Due ☐	OTHER: ☐					

Work Order ID 135164***135164***

Page 2

July 31, 2015 3:25:08 PM

Item ID: D350-748-243TRN

Accept

N900040100Setup Start ***NS1***

Revision ID:

Stop ***NS2***

Item Name: Crosstube Installation, High Aft

Start Date: 7/31/2015 Start Qty: 1.00

1

Cust Item ID:

Required Date: 8/14/2015 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start ***NR1***

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

120

0.00

120

MORI SEIKI CNC LATHE LARGE

Mori Seiki

Memo

0.05

Mori Seiki CNC Lathe Large

1-Turn second side as per Folio _____
2- File transition lines smooth.
3-Scribe Part & Batch as per Dwg D350-748-143
FOLIO REV: AA
DWG REV: AA

1 0
mmf
15/08/18

130

QC1- Inspection performed by CMM

0.00

130

QC

Memo

0.00

Quality Control

1 0
mmf
15/08/19
DAS

140

QC8- Inspect parts - second check

0.00

140

QC

Memo

0.00

Quality Control

1 0
47
9-89
15-09-16

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval		
Description Work Order Deviation				Disposition					
Root Cause		FAULT CATEGORY							
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐				
Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐				
Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐				
Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐				
Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐				
Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐				
Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐				
Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐				
LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐				
Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐				
Past Expiry Date ☐	Manufacturing Process ☐	OTHER : _____							
Misidentified ☐	Past Due ☐								

Work Order ID 135164

135164

Page 3

July 31, 2015 3:25:08 PM

Item ID: D350-748-243TRN

Accept

N900040100

Setup Start ***NS1***

Revision ID:

Stop ***NS2***

Item Name: Crosstube Installation, High Aft

Start Date: 7/31/2015 Start Qty: 1.00

1

Cust Item ID:

Required Date: 8/14/2015 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start ***NR1***

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
150		0.00							
150	Large Fab								
Crosstubes	Memo	0.02							
Crosstubes	1-Grind machining marks								
190		0.00							
190	Packaging								
Packaging	Memo	0.00							
Packaging	Identify and stock in kanban rack Location: <u>14103</u>								
200		0.00							
200	QC21- Final Inspection - Work Order Release								
QC	Memo	0.02							
Quality Control									

BL 15/09/17

BL 15/09/17

MLJ SEP 2 1 2015

MLJ SEP 2 1 2015

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐							
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval				
Description Work Order Deviation				Disposition				Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval			
Root Cause		FAULT CATEGORY									
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐	Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐
Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐	Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐
Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐	Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐
Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐	Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐
LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐	Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐
Past Expiry Date ☐	Manufacturing Process ☐	OTHER :									
Misidentified ☐	Past Due ☐										

Picklist Print

July 31, 2015 3:25:13 PM

Page 1

Work Order ID: 135164

135164

Parent Item: D350-748-243TRN

D350-748-243TRN

Parent Item Name: Crosstube Installation, High Aft

Start Date: 7/31/2015

Required Date: 8/14/2015

Start Qty: 1.00

Required Qty: 1.00

Comments: IPP Rev: PRELIM New Issue LL 12.05.08

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Qty per Kit	Total Qty	Qty Issued	Date Issued	Status
D6021-125		Manufactured	No				Each	103.0000		1			

D6021-125

Crosstube Material - 17-4Ph SS

<u>Location</u>	<u>Loc Qty</u>	<u>Loc Code</u>
HALL	71	
127271	35	
<u>127272</u>	16	
85076	20	
LG	32	
127272	32	

_____ 1 mm 15/08/13

Item	Qty -243	Part Number	Description
1	X	D350-748-243	CROSSTUBE ASSEMBLY (AS 350/355 HI AFT)
2	1	D6021-125	CROSSTUBE
3	2	D3502-1	SUPPORT
4	2	D5123-7	CLAMP CUSHION
5	1	AETC-1032	INSERT
6	2	MS21920-20 OR MS21920-21/-22	CLAMP (PER DART SPEC. M-MS21920-20/-21/-22)
7	1	NAS1149C0363R	WASHER (OR AN960C10)
8	1	NAS1635-3-8	SCREW (OR MS51958-63)
9	A/R	PROSEAL 890 B-2	SEALANT, AMS-S-8802 CLASS B-2

GENERAL NOTES:

- 1) MATERIAL: MANUFACTURED FROM D6021-125
FINISHED LENGTH AFTER TURNING = 124.70±0.06 (AFTER BENDING/TRIMMING = 122.70 REF)
- 2) FINISH: PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2
PAINT OUTSIDE PER DART QSI 005 4.2
- 3) TOLERANCE: PER DART QSI 018 UNLESS OTHERWISE NOTED.
WALL THICKNESS ECCENTRICITY PER DART QSI 038 7.2
MIN. ALLOWABLE WALL IS -0.020 FROM NOMINAL
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED.
- 5) BREAK SHARP EDGES: 0.005 TO 0.010 MAX.
- 6) IDENTIFICATION: DART PART NUMBER "D350-748-243" AND BATCH NUMBER ON INSIDE OF CUFF
PER DART QSI 044 6.4 (VIBRATING STYLUS)
- 7) WEIGHT: 29.85 lbs
- 8) PART IS SYMMETRIC ABOUT CENTERLINE, EXCEPT FOR Ø0.290 HOLE.
- 9) EXTREME CARE MUST BE TAKEN TO PROTECT THE OUTSIDE SURFACE OF THE TUBE. THE OUTSIDE SURFACE MUST BE SMOOTH AND FREE FROM SURFACE DEFECTS SUCH AS SCRATCHES, NICKS, OR DENTS. DEFECTS UP TO 0.005" MAY BE BLENDED OUT LONGITUDINALLY. CIRCUMFERENTIAL GRIND MARKS ARE UNACCEPTABLE. WHEN DRILLING HOLES EXTREME CARE MUST BE TAKEN AND CAREFUL DEBURRING PERFORMED TO ENSURE A CLEAN HOLE WITH NO CRACKING/CHIPPING/GROOVES.

TURNING

- 10) BLEND OUT ALL EDGES FROM MACHINING LONGITUDINALLY, TRANSITION SHOULD BE SMOOTH. NOTE: ALL HOLES ARE DRILLED AFTER BENDING.

BENDING

- 11) BEND PROGRESSIVELY WITH A MINIMUM OF 7 PASSES PER SIDE. MAXIMUM TUBE FLATTENING DUE TO BENDING IS 6% BASED ON O.D. ON TOP HALF OF BEND, AND 8% ON BOTTOM HALF OF BEND.
- 12) MAX AMPLITUDE OF RIPPING ALONG BENT PORTION OF THE TUBE IS 0.030 (ZN A1-3)
- 13) MAX TWIST: WITH XTUBE LAYED FLAT ON SURFACE, THE DIFFERENCE BETWEEN CUFF HEIGHTS FROM THE SURFACE MAY BE NO LARGER THAN 0.38 (ZN C1-3).

ASSEMBLY

- 14) TO INSTALL D3502-1 SUPPORT: ABRASE MATING SURFACE OF SUPPORT AND CROSSTUBE WITH 180-GRIT SANDPAPER AND REMOVE RESIDUE WITH MEK (OR EQUIVALENT). APPLY A 0.02" TO 0.05" THICK LAYER OF PROSEAL 890 CLASS B-2 (OR AMS-S-8802 CLASS B-2) SEALANT TO MATING SURFACE OF SUPPORT.
- 15) TORQUE CLAMPS 60 TO 80 IN.-LB. ENSURE AT LEAST 1.5 THREADS SHOWING IN SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING. PRIOR TO PACKAGING, RE-CHECK TORQUE ON CLAMPS AFTER PROSEAL 890 SEALANT HAS CURED FOR 72 HOURS.

135164
SA 80150807

RELEASED

2015 MAR 18

ECN 15-547

UNDER REVIEW


15/14/28
LRF 15-541



A	NEW ISSUE	CP	15.01.21
REV.	DESCRIPTION	BY	DATE
DESIGN			
DRAWN			
CHECKED			
MFG. APPR.			
APPROVED			
DE APPR.			
DATE	15.01.21		

DART AEROSPACE LTD
HAWKESBURY, ONTARIO, CANADA



DRAWING NO. D350-748-243
TITLE CROSSTUBE (AS 350/355 HI AFT)
REV. A
SHEET 1 OF 4
SCALE NTS

COPYRIGHT © 2015 BY DART AEROSPACE LTD
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR DISSEMINATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.

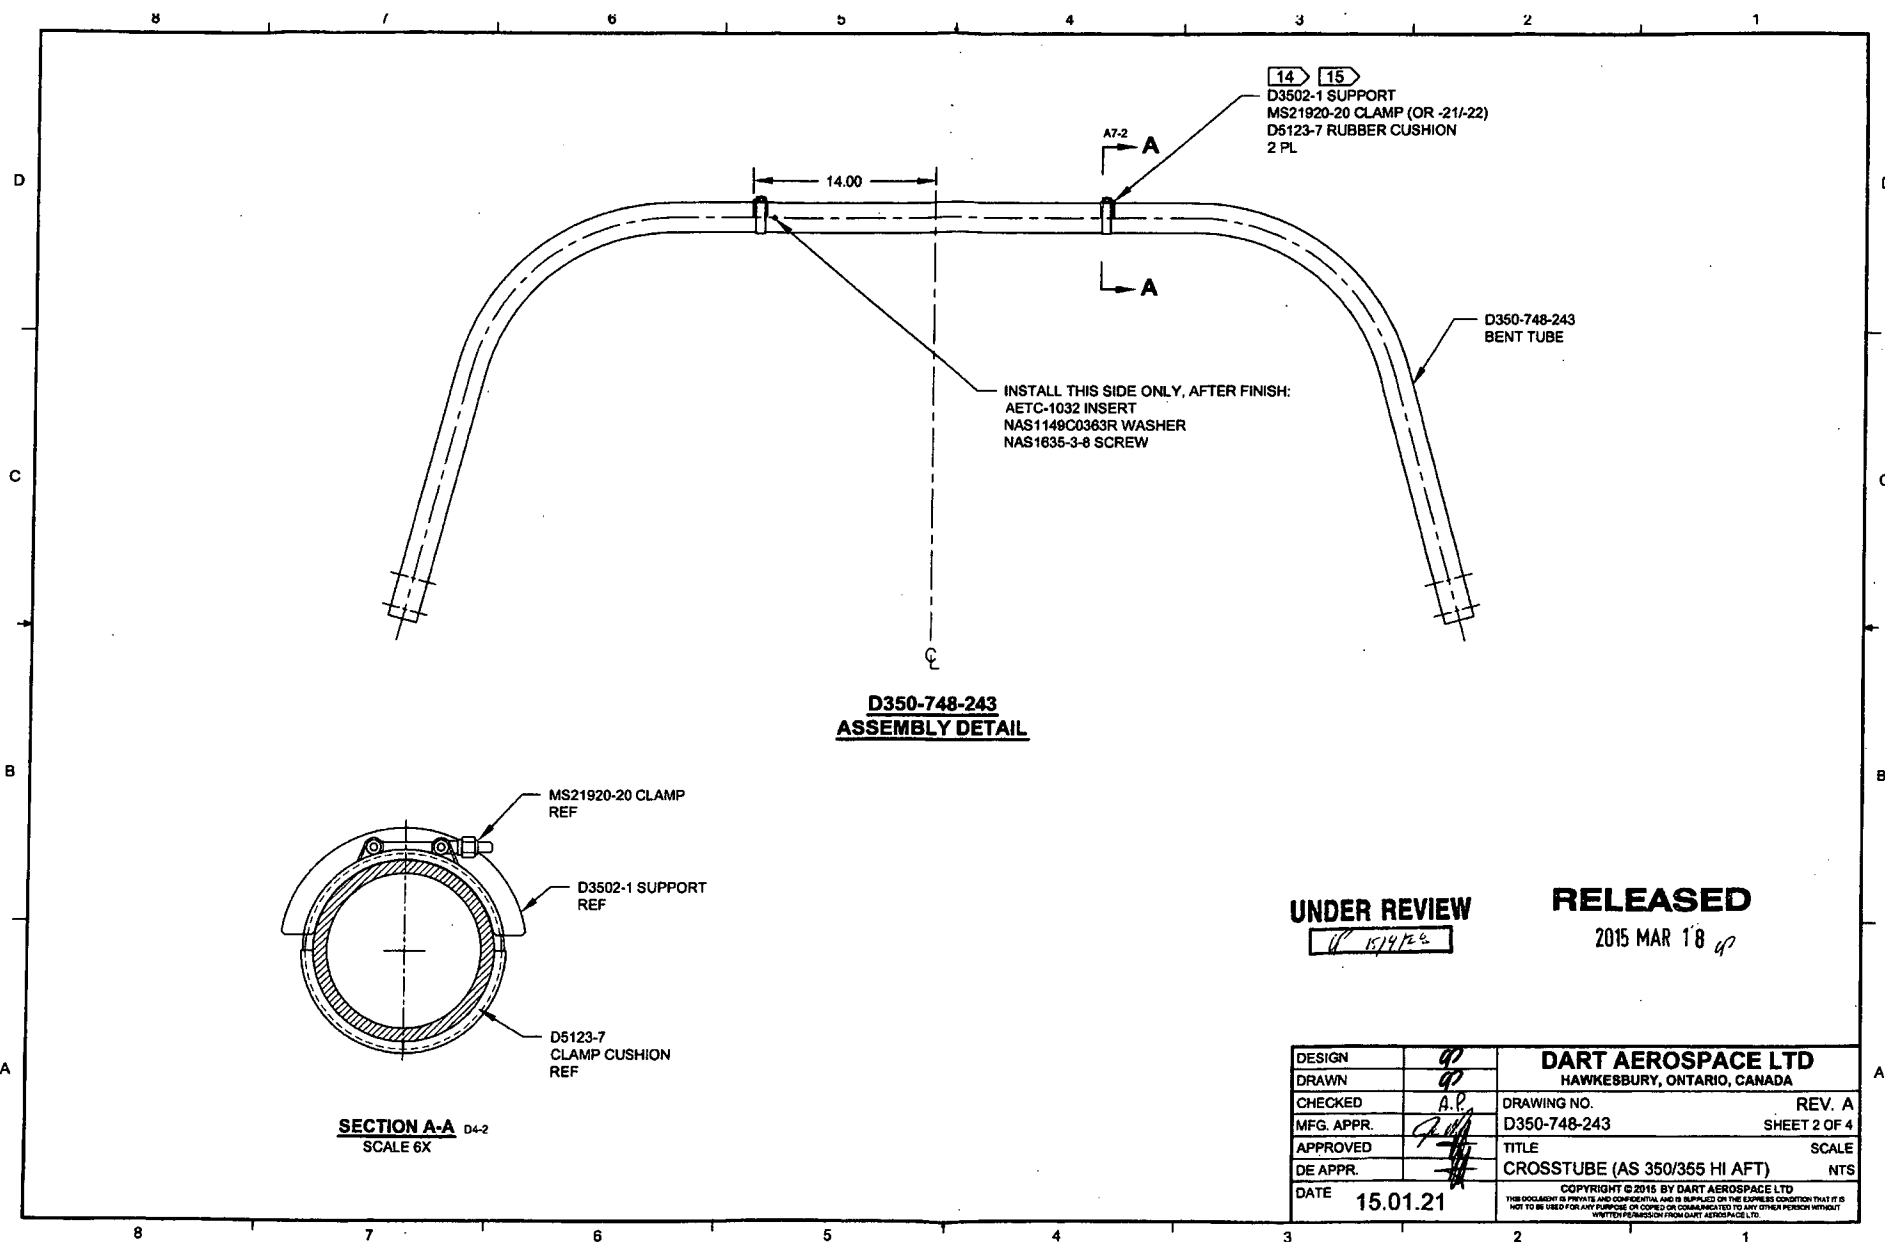

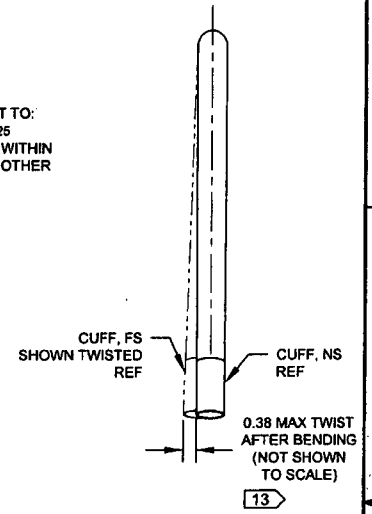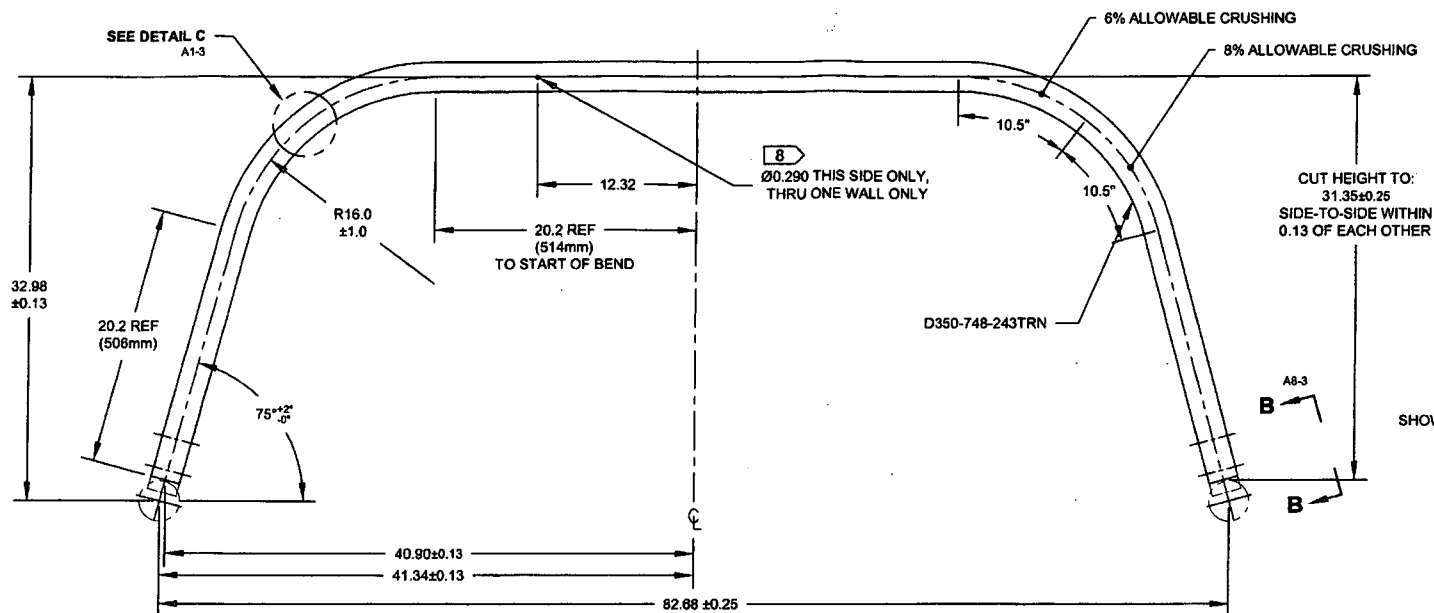


D350-748-243
BENDING AND DRILLING DETAIL 11

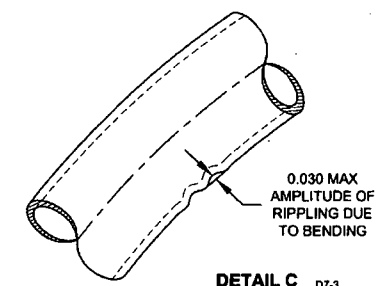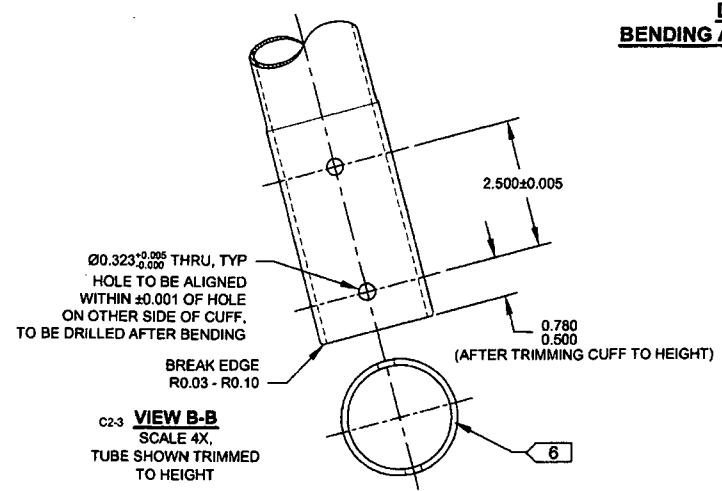

RELEASED
2015 MAR 18

UNDER REVIEW
15/14/12

DESIGN	10	DART AEROSPACE LTD	
DRAWN	10	HAWKESSBURY, ONTARIO, CANADA	
CHECKED	A.P.	DRAWING NO.	REV. A
MFG. APPR.		D350-748-243	SHEET 3 OF 4
APPROVED		TITLE	SCALE
DE APPR.		CROSSTUBE (AS 350/355 HI AFT)	NTS
DATE	15.01.21	COPYRIGHT © 2015 BY DART AEROSPACE LTD	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.			

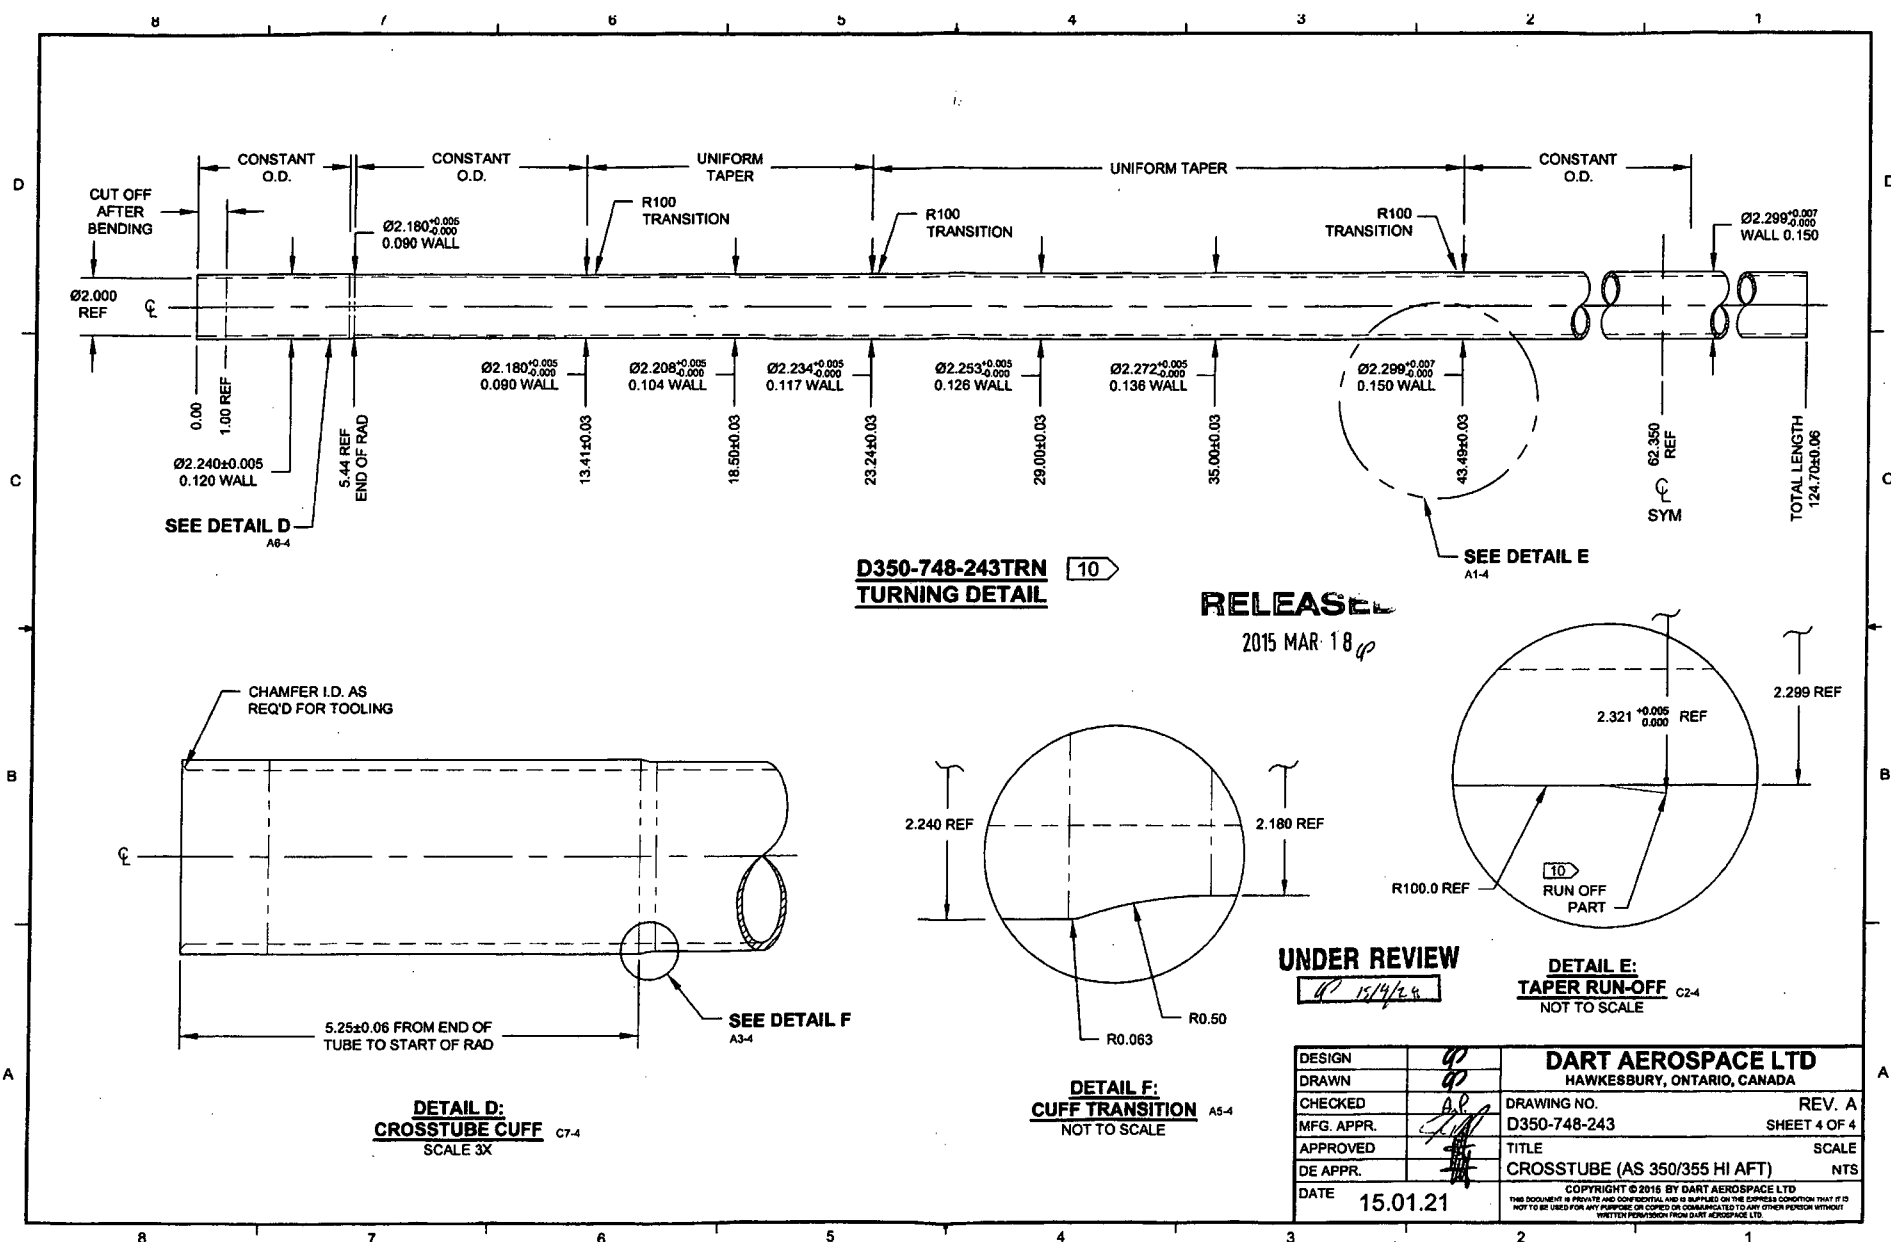

DART AEROSPACE LTD		Work Order:	135164
Description: Crosstube Assembly (AS350/355 High Aft)		Part Number:	D350-748-241
Inspection Dwg: D350-748-241 Rev: <i>1 A m m L</i>		Page 1 of 2	

243
mmL


FIRST ARTICLE INSPECTION CHECKLIST

Inspection Sheet Drawing Dimension	Tolerance	Actual Dimension	Accept	Reject	Method of Inspection	Comments
SIDE A	2.240	+0.005/-0.000	2.244	/		
	2.180	+0.005/-0.000	2.183	/		
	2.180	+0.005/-0.000	2.182	/		
	2.208	+0.005/-0.000	2.210	/		
	2.234	+0.005/-0.000	2.235	/		
	2.253	+0.005/-0.000	2.254	/		
	2.272	+0.005/-0.000	2.276	/		
	2.299	+0.005/-0.000	2.304	/		
	0.063	+/-0.010	.063	/		
	5.25	+/-0.060	5.260	/		
	R0.063	+/-0.010	.063	/		
	R0.50	+/-0.030	.500	/		
SIDE B	2.240	+0.005/-0.000	2.244	/		
	2.180	+0.005/-0.000	2.183	/		
	2.180	+0.005/-0.000	2.184	/		
	2.208	+0.005/-0.000	2.212	/		
	2.234	+0.005/-0.000	2.236	/		
	2.253	+0.005/-0.000	2.254	/		
	2.272	+0.005/-0.000	2.277	/		
	2.299	+0.005/-0.000	2.303	/		
	0.063	+/-0.010	.063	/		
	5.25	+/-0.060	5.26	/		
	R0.063	+/-0.010	.063	/		
	R0.50	+/-0.030	.500	/		
	124.70	+/-0.060	124.70	/		

DART AEROSPACE LTD		Work Order:	
Description: Crosstube Assembly (AS350/355 High Aft)		Part Number:	D350-748-244
Inspection Dwg: D350-748-241 Rev: A mm L		Page 2 of 2	

243
mm L

WALL THICKNESS MEASUREMENT

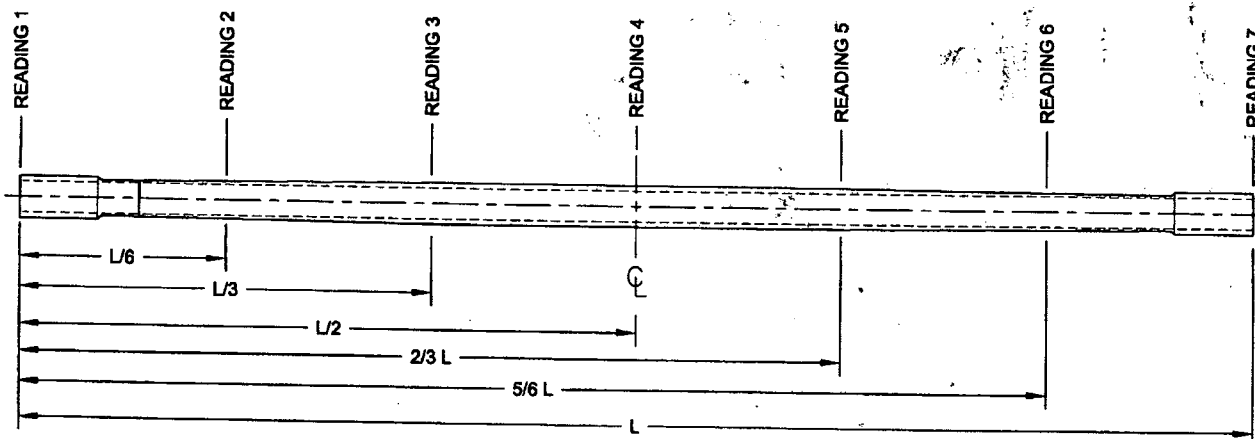

Location	WALL THICKNESS MEASUREMENT (IN)				Deviation Δw (max-min)	TOLERANCE
	w1	w2	w3	w4		
READING 1 L = 0"	.129	.126	.129	.132	.006	0.030"
READING 2 L = 21	.131	.110	.107	.125	.024	
READING 3 L = 42	.165	.157	.145	.152	.020	
READING 4 L = 62	.159	.155	.157	.160	.005	
READING 5 L = 83	.148	.163	.165	.148	.017	
READING 6 L = 104	.107	.140	.136	.093	.047	
READING 7 L = 124	.128	.133	.130	.125	.008	

Dwg A

0.111 0.019

Calibration Result

DAS
47

Actual Block Thickness: 100.500

Sitescan 250 Measured Thickness: 100.500

Measured by:	mm L
Date:	15/08/19

Audited by:	9-89
Date:	15-09-16

Preliminary Approval:	
Date:	

Rev	Date	Change	Revised by	Approved
B	12.02.02	Dwg Rev updated (P/O D350-748-201)	KJ	
C	12.06.04	Wall thickness form added	KJ	
D	13.02.27	Dimension 5.25 was 4.26	KJ	
E	14.04.25	122.70 dimension revised to 124.70	KJ	
F	15.04.14	Dwg Rev updated	KJ	